

Work Order Tracking (Tr)

Find Work Order



Select Action



List

Work Order

Plans

Actuals

Activities

Measurements

Axle Configuration

Related Records

Safety Plan

Log

Work Order: 1760656

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset:

Alias:

Location: CHAIN_MARK Metro Chain Markers

Work Location:

Work Type: PM

Status: APPR

Status Date: 01/07/15 05:47:54 AM

Reported By: MTACRON

Phone:

Reported Date: 01/02/15 03:09:02 AM

On Behalf Of:

Consist:

Asset Details

Year:

Manufacturer:

Model:

Serial #:

Type:

Status:

Asset Condition:

Address Information

Service Address:

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Dennis Brockmeyer, Nelson Date 1/12/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1760656

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.			1		171-B	C-15	D-22	Y	N	16666333
2.			1	N	133-A	J-02	D-20	Y	N	1441909
3.			3		137	C-05	D-22	Y	N	16666776
4.			2		163	C-05	D-22	Y	N	166665736
5.			15		19A	S-05	D-01	Y	N	1459943
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	Contact rail ends mismatch.
2.	Standard Joint, one end is loose
3.	Contact rail end mismatch.
4.	Contact rail end mismatch.
5.	Frog point & riser need welding.

Dennis Brockmeyer, Nelson
 Trackwalkers Signature

[Signature]
 Supervisory Certification

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully

Find Work Order

Select Action

List

Work Order

Plans

Actuals

Activities

Measurements

Axle Configuration

Related Records

Safety Plan

Log

Work Order: 1768484

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset:

Alias:

Location: CHAIN_MARK Metro Chain Markers

Work Location:

* Work Type: PM

Status: APPR

Status Date: 01/09/15 06:27:51 AM

Reported By: MTACRON

Phone:

Reported Date: 01/09/15 03:05:38 AM

On Behalf Of:

Consist:

Asset Details

Year:

Manufacturer:

Model:

Serial #:

Type:

Status:

Asset Condition:

Address Information

Service Address:

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Jefferson, Nelson, Dennis, Greenwood Date 01-15-15 Page 1 of 1
(Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1768484

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.	3644.50		2	N	167B	J-01	D-40	R	N	1731452
2.	3644.50		2	S	167B	J-01	D-40	Y	N	1775340
3.			2	S	167B	S-04	D-40	Y	N	1731452
4.			2	S	167B	S-03	D-40	R	N	1731452
5.	3644.55		2	S	167B	S-02	D-40	R	N	1731452
6.	3646.00		1	N	167A	S-05	D-40	R	N	914399
7.			1	N	167A	S-04	D-40	R	N	914399
8.			1	N	167A	S-02	D-40	R	N	1775366
9.	3646.80		15	N		R-01	D-40	R	N	1775356
10.			11	N	151	S-02	D-40	R	N	914415
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1	Side wear angle 31° on IJ
2	Side wear angle 25° on IJ
3	Side wear angle 23° on LH STR SW PT
4	Side wear angle 27° on Curve Closure rail
5	Side wear angle 31° on Stock rail.
6	Side wear angle 27° on Frog Heel
7	Side wear angle 31° on LH CU SW PT
8	Side wear angle 31° on LH STR ST. RL.
9	Side wear angle 23° on Running of IJ west of 171A
10	Side wear angle 27° on LH CU ST. RL

Richard Nelson
Trackwalkers Signature

[Signature]
Supervisory Certification

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully

Find Work Order



Select Action



List

Work Order

Plans

Actuals

Activities

Measurements

Axle Configuration

Related Records

Safety Plan

Log

Work Order: 1776149

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO



Classification Description: MTA - METRO

Asset:



Alias:

Location: CHAIN_MARK >> Metro Chain Markers



Work Location:



* Work Type: PM



Status: APPR

Status Date: 01/17/15 06:00:15 AM

Reported By: MTACRON



Phone:

Reported Date: 01/16/15 03:05:50 AM



On Behalf Of:



Consist:



Asset Details

Year:

Manufacturer:



Model:



Serial #:

Type:



Status:

Asset Condition:

Address Information

Service Address:



City:

Formatted Address:

State/Province:

Street Address:




WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name J. Chase, W. Greenwood Date 01-21-15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1776149

Item	Exception Chain Marker No.		Track	Rail	Switch	Codes		Status	Repair	W. O.
	From	To	No.	N/S	No.	Comp.	Defect	S/Y/R	Y/N	
1.	347+90		2			T03	D-09	S	N	1452021
2.			2		127A	T03	D-09	S	N	1755162
3.	354+00		1		129A	T03	D-09	Y	N	914439
4.			15		171A	T03	D-09	S	N	1737754
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	2 concrete ties in a row cracked
2.	1 concrete tie cracked
3.	7 concrete ties cracked
4.	1 concrete tie cracked


 Trackwalkers Signature


 Supervisory Certification

Work Order Tracking (Tr)

Bulletins: (2) [Go To](#)

Work Order



Select Action



List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1783589

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO



Classification Description: MTA - METRO

Asset:



Alias:

Location: CHAIN_MARK Metro Chain Markers



Work Location:



* Work Type: PM



Status: APPR

Status Date: 01/24/15 05:42:16 AM

Reported By: MTACRON



Phone:

Reported Date: 01/23/15 03:04:36 AM



On Behalf Of:



Consist:



et Details

Year:

Manufacturer:



Model:



Serial #:

Type:



Status:

Asset Condition:

Address Information

Service Address:



City:

Formatted Address:

State/Province:



Street Address:



WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name M. Alchin K. Nelson Date 4/29/15 Page 1 of 1
(Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1783589

[illegible]

Item	COMMENTS
------	----------

[illegible]

Richard Nelson
Trackwalkers Signature


Supervisory Certification

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully.

Notifications: (2)

Go To

Work Order

Select Action

List Work Order Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1791014

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset:

Alias:

Location: CHAIN_MARK Metro Chain Markers

Work Location:

Work Type: PM

Status: APPR

Status Date: 01/30/15 05:18:22 PM

Reported By: MTACRON

Phone:

Reported Date: 01/30/15 03:06:40 AM

On Behalf Of:

Consist:

Details

Year:

Manufacturer:

Model:

Serial #:

Type:

Status:

Asset Condition:

Address Information

Service Address:

Formatted Address:

Street Address:

City:

State/Province:


WEEKLY TRACK WALKING INSPECTION REPORTING FORM


Name Greenwood, Alchin, Nelson Date 2/5/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1791014

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.			2	S	165	J-01	D-20	Y	N	
2.			15A		19A	S-05	D-41	Y	N	1459943
3.			1		171B	C-15	D-22	Y	N	16666333
4.										
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	3 bolts on the west side of the insulated joint are tight, but the left hand straight stock rail of SW 167B is loose in the insulated joint. Stock rail has horizontal movement.
2.	Flag is battered.
3.	3rd rail mismatch


Trackwalkers Signature


Supervisory Certification

Work Order Tracking (Tr)

Bulletins: (2) Go To

Work Order

Select Action

List Work Order Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1800970 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

* Work Type: PM

Status: APPR

Status Date: 02/06/15 06:20:35 AM

Reported By: MTACRON >>

Phone:

Reported Date: 02/06/15 03:07:03 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

City:

Formatted Address:

State/Province: >>

Street Address: >>

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Alchin, Chase, Nelson Date 2/10/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1800970

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.				3	137	C-05	D-22	Y	N	1666776
2.				2	163	C-14	D-22	Y	N	1665736
3.				1	1713	C-14	D-22	Y	N	16666333
4.										
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	3 rd rail end approach mismatch
2.	3 rd rail mismatch
3.	3 rd rail mismatch

Richard Nelson [Signature]
 Trackwalkers Signature Supervisory Certification

Work Order Tracking (Tr)

BMXAA45911 - Status change(s) completed successfully.

Bulletins (1)

Go To

Work Order

Select Action

List

Work Order

Plans

Actuals

Activities

Measurements

Axle Configuration

Related Records

Safety Plan

Log

Failure Reporting

Work Order: 1808997

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

* Work Type: PM

Status: APPR

Status Date: 02/13/15 11:57:52 AM

Reported By: MTACRON >>

Phone:

Reported Date: 02/13/15 03:08:39 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Chase Greenwood Nelson Date 2-19-15 Page 1 of 1
(Please Print)

Inspected From	W / YARD	To	E / YARD	Yard Tr #	All	WO#	1808997
----------------	----------	----	----------	-----------	-----	-----	---------

[illegible]

Item	COMMENTS
------	----------

[illegible]

Richard Nelson
Trackwalkers Signature


Supervisory Certification

Work Order	Description	Work Location	Status	Reported Date
51639	YARD W Coverbrd/Splice Plate Yd1 368+80	368W	APPR	01/29/13 11:33:00 AM
51639	YARD W Out of Surface Yd1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1452021	YARD Trk #2, CM 347+90, 2 in-a-row cracked concrete ties	CMWABYARD	MONITOR	04/04/14 07:30:07 AM
914431	YARD E Ties Cracked(3) YD11 SW101 344+20	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
890587	YARD E Sw Pt & Running rail Side Worn Yd11 S W 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1776742	Yard, Trk 11, Sw# 107, LH STR ST RL angle wear 30 degrees	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1454677	YARD , Trk #3, Sw#111, dime size chip in Sw. Pt.	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1510404	YARD E trk #3 Sw. 111 Frog point chipped	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1703988	Yard E, Sw# 111, Trk 3, Sw Pt & closure rail side wear	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1524195	YARD E trk 3, Sw# 113, Sw. PT.& Cl. rail & Frog side wear	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
1524200	YARD E ladder trk. S. rail 1 trk bolt missing	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1776740	YARD Trk 6, Sw# 117, LH STR ST RL Angle wear 22 degrees	WABYARDSW117	APPR	01/16/15 03:57:01 PM
1776741	YARD Trk 6, Sw# 119, LH STR ST RL angle wear 22 degrees	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E, Sw123, Sw Pt & Closure & running rail side worn	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
1755162	YARD Sw.# 127-A, Track #2, Broken concrete tie	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
1755162	YARD E, Sw Pt & running rail Worn Yd1 127A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
914439	YARD M Ties Cracked (7) Yd1 129A CM354	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD, Trk #1, Sw. #133A, N.Rail, St. JT. rail is loose	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1666776	YARD W Sw. 137, west end approach mismatch	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1703973	YARD W, Sw # 141, TRk 5, Sw Pt has side wear	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
1703986	YARD W, Sw # 143, Trk 5, Sw Pt is side worn	WABYARDSW143	APPR	11/11/14 04:31:27 PM
1776739	YARD Trk 11, Sw# 151, LH CV ST RL Angle wear 27 degrees	WABYARDSW151	APPR	01/16/15 03:52:29 PM
914415	YARD W Sw. Pt. Worn Yd11 Sw151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
1742183	YARD Sw# 161, running rail top worn, battered IJ	WABYARDSW161	APPR	12/16/14 06:18:09 AM
1665736	YARD W Sw.163, 3rd rail mismatch&burnt	WABYARDSW163	APPR	10/07/14 03:25:07 PM
1775340	YARD Sw# 165, IJ on stock rail has 25 degrees side wear	WABYARDSW165B	APPR	01/15/15 02:40:35 PM
1790136	YARD Sw# 165, South running rail top worn	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
1775366	YARD trk#1, Sw# 167A, LH stock rail 31 degrees wear	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
914399	YARD W 167-A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1731452	YARD Trk#1, Sw.167B, frog bolts loose	WABYARDSW167B	APPR	09/29/14 12:21:27 PM
1731452	YARD track #2,Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM

1775356	YARD CM366+80, trk 15, Running rail worn 33 d egrees	WABYARDSW171A	APPR	01/15/15 02:46:17 PM
1 754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1703971	YARD W, Sw # 171A, Trk 15, North running rail side worn	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM
1808997	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	02/13/15 03:08:39 AM

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully.

Notifications: (1)

Go To

Find Work Order



Select Action



List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1817463

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

* Work Type: PM

Status: APPR

Status Date: 02/21/15 06:11:27 AM

Reported By: MTACRON >>

Phone:

Reported Date: 02/20/15 03:19:57 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name A. Jefferson, R. Nelson Date 2/27/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1817463

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.			2	S	1105	Jolt/502	D-20	Y	N	1775340
2.			3		103	F14	11-110	Y	N	1826543
3.										
4.										
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	Stock rail is loose at insulated joint (bolts tight) side wear angle still at 25°
2.	Frog bolt loose, nut and lock washer missing

Rickard Nelson
 Trackwalkers Signature

[Signature]
 Supervisory Certification

Work Order Tracking (Tr) Bulletins: (2) [Go To](#)

Find Work Order

Select Action

[Print](#) [Refresh](#) [Back](#) [Forward](#) [Home](#) [List](#) [Work Order](#) [Plans](#) [Actuals](#) [Activities](#) [Measurements](#) [Axle Configuration](#) [Related Records](#) [Safety Plan](#) [Log](#) [Failure Reporting](#)

List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1826039 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset:

Alias:

Location: CHAIN_MARK Metro Chain Markers

Work Location:

Work Type: PM

Status: APPR

Status Date: 02/28/15 05:20:21 AM

Reported By: MTACRON

Phone:

Reported Date: 02/27/15 03:08:18 AM

On Behalf Of:

Consist:

Asset Details

Year:

Manufacturer:

Model:

Serial #:

Type:

Status:

Asset Condition:

Address Information

Service Address:

City:

Formatted Address: State/Province:

Street Address:

Name CHASE, MIKE, RICH
(Please Print)

Page 1 of 1

[illegible]

COMMENTS

[illegible]

Trackwalkers Signature

Supervisory Certification

Wabash Yard 2-28-15

Page 1

Work Order	Description	Work Location	Status	Reported Date
51639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1452021	YARD Concrete Ties Cracked (2) Consecutive Yd 2 CMWABYARD 347+90		MONITOR	04/04/14 07:30:07 AM
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+2	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
1826543	Yard E Sw.103 Loose frog bolt	WABYARDSW103	APPR	02/27/15 03:16:50 PM
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1524200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1524195	YARD E Switch Point / Closure Rail / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM
1776741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 35	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 13	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
1703986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM
1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM
914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
1742183	YARD IJ Battered / Running Rail Top Worn SW 16	WABYARDSW161	APPR	12/16/14 06:18:09 AM
1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM
175340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) SW 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM

1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1655044	YARD Trk#1, Sw.167B, frog bolts loose	WABYARDSW167B	APPR	09/29/14 12:21:27 PM
1731452	YARD track #2, Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM
1703971	YARD W, Sw # 171A, Trk 15, North running rail side worn	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1775356	YARD CM366+80, trk 15, Running rail worn 33 degrees	WABYARDSW171A	APPR	01/15/15 02:46:17 PM
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM
1817463	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		COMP	02/20/15 03:19:57 AM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1826039	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	02/27/15 03:08:18 AM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM

Work Order Tracking (Tr)

Bulletins: (1) Go To

Find Work Order

Select Action



List Work Order Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1837026 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

Work Type: PM

Status: APPR

Status Date: 03/09/15 09:06:20 AM

Reported By: MTACRON

Phone:

Reported Date: 03/06/15 03:04:10 AM

On Behalf Of:

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

City:

Formatted Address:

State/Province:

Street Address:


WEEKLY TRACK WALKING INSPECTION REPORTING FORM

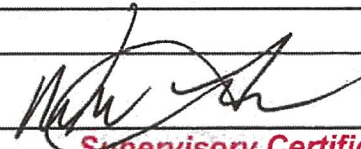
Name M. Alchin, J. Chase, A. Jefferson Date 3/14/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1837026

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.			1	N	167A	5-02	D-40	Y	N	1775366
2.			2		167B	502	D-40	Y	N	1731452
3.			2		167B	503	D-40	Y	N	1731452
4.			2		167B	504	D-40	Y	N	1731452
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	Left hand straight stock rail 31° wear angle.
2-4	Stock rail, switch point and closure rail 28° wear angle.


 Trackwalkers Signature


 Supervisory Certification

Work Order Tracking (Tr)

Bulletins: (2) [Go To](#)

Find Work Order



Select Action



List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1846109 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: »

Alias:

Location: CHAIN_MARK » Metro Chain Markers

Work Location: »

Work Type: PM

Status: APPR

Status Date: 03/14/15 02:57:10 PM

Reported By: MTACRON »

Phone:

Reported Date: 03/13/15 03:06:10 AM

On Behalf Of: »

Consist: »

Asset Details

Year:

Manufacturer: »

Model: »

Serial #:

Type: »

Status:

Asset Condition:

Address Information

Service Address: »

Formatted Address:

Street Address:

City:

State/Province: »

Name Nelson, Brennan, Albin Date 3-18-15 Page 1 of 1
(Please Print)

[illegible][illegible]


Supervisory Certification

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully.

Buttons: (1)

Go To

Find Work Order

Select Action

List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1854540

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset:

Alias:

Location: CHAIN_MARK Metro Chain Markers

Work Location:

✱ Work Type: PM

Status: APPR

Status Date: 03/20/15 06:13:33 AM

Reported By: MTACRON

Phone:

Reported Date: 03/20/15 03:03:01 AM

On Behalf Of:

Consist:

Asset Details

Year:

Manufacturer:

Model:

Serial #:

Type:

Status:

Asset Condition:

Address Information

Service Address:

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name A. JEFFERSON W GREENWOOD Date 3-25-15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1854540

Item	Exception Chain Marker No.		Track	Rail	Switch	Codes		Status	Repair	W. O.
	From	To	No.	N/S	No.	Comp.	Defect	S/Y/R	Y/N	
1.	347+85		2	N/S		T07	DOF	Y	N	1452021
2.			15		171-A	T07	DOF	Y	N	1737754
3.										
4.										
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1	2 CONCRETE TIES CRACKED
2	1 CONCRETE TIES CRACKED


 Trackwalkers Signature


 Supervisory Certification

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully.

Publications: (2)

Go To

Find Work Order

Select Action

List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1862660

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

Work Type: PM

Status: APPR

Status Date: 03/28/15 06:18:31 AM

Reported By: MTACRON >>

Phone:

Reported Date: 03/27/15 03:04:27 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #: >>

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name R. Nelson, M. Alchin Date 4/6/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1862660

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.					163	T-06	D-31	S	N	1872845
2.					133B	T-06	D-31	S	N	1872848
3.					137	F-06	D-31	S	N	1872851
4.										
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1-3	Tie saver Rod is coming off Ties.

R. Nelson
 Trackwalkers Signature

[Signature]
 Supervisory Certification

Wabash Yard 3-28-15

Page 1

Work Order	Description	Work Location	Status	Reported Date
1639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1452021	YARD 2 Concrete Ties Cracked Yd Tr 2 347+90	CMWABYARD	MONITOR	04/04/14 07:30:07 AM
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+2	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1524200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1524195	YARD E Switch Point / Closure Rail / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM
6741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 354	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 133 A	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
1703986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM
1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM
914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
1742183	YARD IJ Battered / Running Rail Top Worn SW 161	WABYARDSW161	APPR	12/16/14 06:18:09 AM
1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM
1775340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) SW 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM

1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
1731452	YARD track #2,Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM
1775356	YARD CM366+80, trk 15, Running rail worn 33 degrees	WABYARDSW171A	APPR	01/15/15 02:46:17 PM
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1703971	YARD W, Sw # 171A, Trk 15, North running rail side worn	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM
1862671	Tri-Monthly Yard SWINSP Track 2,3,4		APPR	03/27/15 03:04:34 AM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM
1862660	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	03/27/15 03:04:27 AM

Work Order Tracking (Tr) Bulletins: (1) [Go To](#)

Find Work Order Select Action

List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1872777 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset:

Alias:

Location: CHAIN_MARK Metro Chain Markers

Work Location:

* Work Type: PM

Status: APPR

Status Date: 04/03/15 06:18:24 AM

Reported By: MTACRON

Phone:

Reported Date: 04/03/15 03:08:58 AM

On Behalf Of:

Consist:

Asset Details

Year:

Manufacturer:

Model:

Serial #:

Type:

Status:

Asset Condition:

Address Information

Service Address: City:

Formatted Address: State/Province:

Street Address:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Nelson, Chase, Jefferson Date 4-11-15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1872777

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.			13W		139	S03	D-40	Y	N	1882554
2.			13W		139	S04	D-40	Y	N	1882554
3.			11W		151	S03	D-40	Y	N	1882557
4.			2E		127B	T03	D-03	Y	N	1882563
5.			3E		111	S03	D-40	Y	N	1703988
6.			3E		113	S-03-0204	D-40	Y	N	1524195
7.			11E		107	T03	D-11	Y	N	1882581
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1.	Curve closure 26° Angle wear
2	Right hand curve switch point 26° Angle wear.
3	Curve closure 25° angle wear
4	One broken concrete Tie under I 3 ahead of SW 127B
5	Curve closure rail 25° angle wear
6	STRL, SW PT, CUCLRL 25° angle wear
7	One deteriorating concrete Tie under standard Joint ahead of 107 SW.

Richard Nelson
 Trackwalkers Signature

[Signature]
 Supervisory Certification

Wabash Yard 4-3-15

Page 1

Work Order	Description	Work Location	Status	Reported Date
2021	YARD 2 Concrete Ties Cracked Yd Tr 2 347+90	348W	MONITOR	04/04/14 07:30:07 AM
951639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+2	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1524200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1524195	YARD E Switch Point / Closure Rail / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM
5741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 35	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 13	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1872848	Yard Track2W Sw133B Tie saver pad missing on closure rail	WABYARDSW133B	APPR	04/03/15 05:49:29 AM
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1872851	Yard Track3W Sw137 Tie saver pad missing on closure rail.	WABYARDSW137	APPR	04/03/15 05:52:29 AM
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
1703986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM
1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM
914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
21831	YARD IJ Battered / Running Rail Top Worn SW 16	WABYARDSW161	APPR	12/16/14 06:18:09 AM

1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM
1872845	Yard Track 2W Sw 163 Tie saver pad missing on closure rail	WABYARDSW163	APPR	04/03/15 05:37:09 AM
1775340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) S W 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM
1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
1731452	YARD track #2, Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM
1775356	YARD CM366+80, trk 15, Running rail worn 33 degrees	WABYARDSW171A	APPR	01/15/15 02:46:17 PM
1703971	YARD W, Sw # 171A, Trk 15, North running rail side worn	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1872777	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	04/03/15 03:08:56 AM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1862660	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		COMP	03/27/15 03:04:27 AM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM
1872796	Tri-Monthly Yard SWINSP Track 5,6,7,9,11,12		WSCH	04/03/15 03:09:17 AM

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully.

Buttons: (1)

Go To

Find Work Order

Select Action

List

Work Order

Plans

Actuals

Activities

Measurements

Axle Configuration

Related Records

Safety Plan

Log

Failure Reporting

Work Order: 1881274

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

* Work Type: PM

Status: APPR

Status Date: 04/11/15 02:15:47 PM

Reported By: MTACRON

Phone:

Reported Date: 04/10/15 03:06:48 AM

On Behalf Of:

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

Formatted Address:

Street Address:

City:

State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name M Alchin W Greenwood Date 4/16/2015 Page 1 of 1

Inspected From	W/Yard	To	E/Yard	Yard Tr #	All	WO#	1881274
----------------	--------	----	--------	-----------	-----	-----	---------

[illegible]

Item	COMMENTS
------	----------

[illegible]

Michael A. Alchin
Trackwalkers Signature


Supervisory Certification

914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
1882557	YARD W Sw# 151 Curve closure 25 degrees angle wear	WABYARDSW151	APPR	04/11/15 02:42:56 PM
1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM
1742183	YARD IJ Battered / Running Rail Top Worn SW 16	WABYARDSW161	APPR	12/16/14 06:18:09 AM
1872845	Yard Track 2W Sw 163 Tie saver pad missing on closure rail	WABYARDSW163	APPR	04/03/15 05:37:09 AM
1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM
1775340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) S W 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM
1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1731452	YARD track #2, Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1775356	YARD CM366+80, trk 15, Running rail worn 33 degrees	WABYARDSW171A	APPR	01/15/15 02:46:17 PM
703971	YARD W, Sw # 171A, Trk 15, North running rail side worn	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM
1872796	Tri-Monthly Yard SWINSP Track 5,6,7,9,11,12		WSCH	04/03/15 03:09:17 AM
1872777	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	04/03/15 03:08:56 AM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM
1881274	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	04/10/15 03:06:48 AM
1881291	Tri-Monthly Yard SWINSP Track 13,14,15,MM,OM,PO,OC		WSCH	04/10/15 03:06:59 AM

Wabash Yard 4-11-15

Page 1

Work Order	Description	Work Location	Status	Reported Date
1452021	YARD 2 Concrete Ties Cracked Yd Tr 2 347+90	348W	MONITOR	04/04/14 07:30:07 AM
951639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1882554	Yard Sw# 139 RH CV SW PT & CV CL RL 26 degrees angle wear	CMWABYARD	APPR	04/11/15 02:37:22 PM
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+20	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1882581	YARD E Sw# 107 Deteriorated concrete tie under ST JT	WABYARDSW107	APPR	04/11/15 02:58:57 PM
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1524200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1524195	YARD E ST RL / SW PT / CL RL / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM
1776741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
1882563	YARD E Sw# 127B Broken concrete tie under I J	WABYARDSW127B	APPR	04/11/15 02:46:50 PM
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 354	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 133 A	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1872848	Yard Track2W Sw133B Tie saver pad missing on closure rail	WABYARDSW133B	APPR	04/03/15 05:49:29 AM
1872851	Yard Track3W Sw137 Tie saver pad missing on closure rail.	WABYARDSW137	APPR	04/03/15 05:52:29 AM
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
1703986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM

Work Order Tracking (Tr) BMXAA4591I - Status change(s) completed successfully. (1) Go To

Find Work Order

Select Action

List **Work Order** Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1889040

(YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

* Work Type: PM

Status: APPR

Status Date: 04/18/15 12:51:41 PM

Reported By: MTACRON >>

Phone:

Reported Date: 04/17/15 03:11:18 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #: >>

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

City:

Formatted Address:

State/Province: >>

Street Address: >>

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Greenwood Jefferson Date 04/24/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1889040

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.			11		107	S04	D40	Y	N	890587
2.			3		111	S04	D40	Y	N	1703988
3.			5		141	S04	D40	Y	N	1703973
4.			11		151	S04	D40	Y	N	914415
5.			15	N	171A	R01	D40	Y	N	1703971
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1	Switch point side warn.
2	Yard switch point E closure rail side warn.
3	Switch point side warn.
4	Yard switch point side warn.
5	North running rail side warn. 33°

Woodrow Greenwood
 Trackwalkers Signature


 Supervisory Certification

Wabash Yard 4-18-15

Page 1

Work Order	Description	Work Location	Status	Reported Date
1452021	YARD 2 Concrete Ties Cracked Yd Tr 2 347+90	348W	MONITOR	04/04/14 07:30:07 AM
951639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1882554	Yard Sw# 139 RH CV SW PT & CV CL RL 26 degrees angle wear	CMWABYARD	APPR	04/11/15 02:37:22 PM
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+2	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1882581	YARD E Sw# 107 Deteriorated concrete tie under ST JT	WABYARDSW107	APPR	04/11/15 02:58:57 PM
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1524200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1524195	YARD E ST RL/ SW PT/ CL RL / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM
1776741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
1882563	YARD E Sw# 127B Broken concrete tie under I J	WABYARDSW127B	APPR	04/11/15 02:46:50 PM
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 35	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 13	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1872848	Yard Track2W Sw133B Tie saver pad missing on closure rail	WABYARDSW133B	APPR	04/03/15 05:49:29 AM
1872851	Yard Track3W Sw137 Tie saver pad missing on closure rail	WABYARDSW137	APPR	04/03/15 05:52:29 AM
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
13986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM

914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
1882557	YARD W Sw# 151 Curve closure 25 degrees angle wear	WABYARDSW151	APPR	04/11/15 02:42:56 PM
1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM
1742183	YARD IJ Battered / Running Rail Top Worn SW 16 1	WABYARDSW161	APPR	12/16/14 06:18:09 AM
1872845	Yard Track 2W Sw 163 Tie saver pad missing on closure rail	WABYARDSW163	APPR	04/03/15 05:37:09 AM
1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM
1775340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) S W 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM
1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167 A	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1731452	YARD track #2, Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1775356	YARD CM366+80, trk 15, Running rail worn 33 degrees	WABYARDSW171A	APPR	01/15/15 02:46:17 PM
1703971	YARD W, Sw # 171A, Trk 15, North running rail side worn	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM
1889040	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	04/17/15 03:11:18 AM
1872796	Tri-Monthly Yard SWINSP Track 5,6,7,9,11,12		APPR	04/03/15 03:09:17 AM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM
1881274	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		COMP	04/10/15 03:06:48 AM
1881291	Tri-Monthly Yard SWINSP Track 13,14,15,MM,OM,PO .OC		WSCH	04/10/15 03:06:59 AM

Work Order Tracking (Tr)

Bulletins: (1) Go Tr

Find Work Order

Select Action

List Work Order Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1899756 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

Work Type: PM

Status: APPR

Status Date: 04/25/15 03:05:45 PM

Reported By: MTACRON

Phone:

Reported Date: 04/24/15 03:07:03 AM

On Behalf Of:

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

Formatted Address:

Street Address: >>

City:

State/Province: >>

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Jefferson Greenwood Date 04/30/15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1899756
~~129756~~

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.	347+90		2	N/S			T01	D09	Y	1452021
2.	344+2		11		101		T01	D09	Y	914431
3.			3		111		S04	D05	Y	1454677
4.	35+00		1		129A		S02	D09	Y	914439
5.	366+80		15	N	171A		R01	D40	Y	1703971
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1	Two cracked concrete ties
2	Three cracked cracked ties
3	switch point chipped
4	seven ties Cracked
5	Running rail side worn 350

Wesley Greenwood
 Trackwalkers Signature

[Signature] 5.1.15
 Supervisory Certification

Work Order	Description	Work Location	Status	Reported Date	Site
32021	YARD 2 Concrete Ties Cracked Yd Tr 2 347+90	348W	MONITOR	04/04/14 07:30:07 AM	METRO
951639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM	METRO
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM	METRO
1882554	Yard Sw# 139 RH CV SW PT & CV CL RL 26 degree es angle wear	CMWABYARD	APPR	04/11/15 02:37:22 PM	METRO
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM	METRO
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM	METRO
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+2	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM	METRO
1882581	YARD E Sw# 107 Deteriorated concrete tie under ST JT	WABYARDSW107	APPR	04/11/15 02:58:57 PM	METRO
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM	METRO
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM	METRO
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM	METRO
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM	METRO
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM	METRO
1524200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM	METRO
4195	YARD E ST RL/ SW PT/ CL RL / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM	METRO
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM	METRO
1776741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM	METRO
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM	METRO
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM	METRO
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM	METRO
1882563	YARD E Sw# 127B Broken concrete tie under I J	WABYARDSW127B	APPR	04/11/15 02:46:50 PM	METRO
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 35	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM	METRO
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 13	WABYARDSW133A	APPR	03/28/14 12:48:56 PM	METRO
1872848	Yard Track2W Sw133B Tie saver pad missing on closure rail	WABYARDSW133B	APPR	04/03/15 05:49:29 AM	METRO
1872851	Yard Track3W Sw137 Tie saver pad missing on closure rail.	WABYARDSW137	APPR	04/03/15 05:52:29 AM	METRO
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM	METRO
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM	METRO
03986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM	METRO

1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM	METRO
914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM	METRO
1882557	YARD W Sw# 151 Curve closure 25 degrees angle wear	WABYARDSW151	APPR	04/11/15 02:42:56 PM	METRO
1742183	YARD IJ Battered / Running Rail Top Worn SW 16 1	WABYARDSW161	APPR	12/16/14 06:18:09 AM	METRO
1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM	METRO
1872845	Yard Track 2W Sw 163 Tie saver pad missing on closure rail	WABYARDSW163	APPR	04/03/15 05:37:09 AM	METRO
1775340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) S W 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM	METRO
1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM	METRO
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM	METRO
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167 A	WABYARDSW167A	APPR	01/15/15 02:51:32 PM	METRO
1731452	YARD track #2, Sw# 167B, ST RL, SW PT, CL RL side worn	WABYARDSW167B	APPR	12/05/14 03:21:50 PM	METRO
1703971	YARD W, CM366+80, Trk 15, North running rail worn 33 degrees	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM	METRO
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM	METRO
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM	METRO
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear		APPR	12/31/14 02:00:17 PM	METRO
1889040	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		COMP	04/17/15 03:11:18 AM	METRO
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM	METRO
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM	METRO
1899756	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	04/24/15 03:07:03 AM	METRO
1881291	Tri-Monthly Yard SWINSP Track 13,14,15,MM,OM,PO,OC		APPR	04/10/15 03:06:59 AM	METRO

Work Order Tracking (Tr)

Bulletins: (2) Go Tr

Find Work Order

Select Action

List Work Order Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1909297 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

Work Type: PM

Status: APPR

Status Date: 05/02/15 06:41:12 AM

Reported By: MTACRON >>

Phone:

Reported Date: 05/01/15 03:30:38 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #:

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

City:

Formatted Address:

State/Province: >>

Street Address: >>

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name R. Nelson, W. Greenwood, M. Alchin Date 5-7-15 Page 1 of 1
 (Please Print)

Inspected From W / YARD To E / YARD Yard Tr # All WO# 1909297

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O.
	From	To				Comp.	Defect			
1.					11.7A	S-05	D-40	Y	N	914399
2.					11.7A	S-04	D-40	Y	N	914399
3.					11.7B	S-02	D-40	Y	N	1731452
4.					11.7B	S-03	D-40	Y	N	1731452
5.					11.7B	S-04	D-40	Y	N	1731452
6.					139	S-04	D-40	Y	N	1756483
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
16.										
17.										
18.										
19.										
20.										

COMMENTS

142	Frog has 27° angle wear, LH SW. Pt. has 33° angle wear.
3	Stock rail has 30° wear angle
4	Curve closure rail has 28° wear angle
5	Left hand switch point 24° wear angle.
16	Right hand switch point has 32° wear angle

R. Nelson
 Trackwalkers Signature

[Signature]
 Supervisory Certification

Work Order	Description	Work Location	Status	Reported Date
32021	YARD 2 Concrete Ties Cracked Yd Tr 2 347+90	348W	MONITOR	04/04/14 07:30:07 AM
951639	YARD W Coverboard / Splice Plate Yd 1 368+80	368W	APPR	01/29/13 11:33:00 AM
914389	YARD W Out of Surface Yd 1 369+20-366+70	369W	HOLD	12/27/12 01:37:09 PM
1882554	Yard Sw# 139 RH CV SW PT & CV CL RL 26 degrees angle wear	CMWABYARD	APPR	04/11/15 02:37:22 PM
914431	YARD E Ties Cracked (3) Yd 11 SW 101 344+2	WABYARDSW101	MONITOR	12/27/12 02:45:04 PM
1818111	Yard Sw101 CM344+50 Mismatch on top of rail	WABYARDSW101	APPR	02/20/15 05:15:02 PM
1818109	Yard Sw101 CM344+25 Mismatch top of rail	WABYARDSW101	APPR	02/20/15 05:07:43 PM
890587	YARD E Switch Point / Running Rail Side Worn Yd 11 SW 107	WABYARDSW107	MONITOR	12/05/12 03:33:00 PM
1882581	YARD E Sw# 107 Deteriorated concrete tie under ST JT	WABYARDSW107	APPR	04/11/15 02:58:57 PM
1776742	YARD LH Stock Rail Side Worn (Angle 30 deg) Yd 11 SW 107	WABYARDSW107	APPR	01/16/15 04:02:59 PM
1510404	YARD E Frog Point Chipped Yd 3 SW 111	WABYARDSW111	APPR	05/27/14 02:28:32 PM
1454677	YARD E Switch Point Chipped Yd 3 SW 111	WABYARDSW111	MONITOR	04/07/14 08:54:37 AM
1703988	YARD E Switch Point / Closure Rail Side Worn Yd 3 SW 111	WABYARDSW111	MONITOR	11/11/14 04:37:11 PM
1524195	YARD E ST RL / SW PT / CI RL / Frog Side Worn Yd 3 SW 113	WABYARDSW113	MONITOR	06/07/14 01:40:51 PM
4200	YARD E Standard Joint Bolt Missing (S/Rail) Ladder Track	WABYARDSW113	INPRG	06/07/14 01:47:59 PM
1776740	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 117	WABYARDSW117	APPR	01/16/15 03:57:01 PM
1776741	YARD LH Stock Rail Side Worn (Angle 22 deg) Yd 6 SW 119	WABYARDSW119	APPR	01/16/15 04:00:00 PM
990496	YARD E Switch Point / Closure / Running Rail Side Worn SW 123	WABYARDSW123	MONITOR	03/02/13 01:24:35 PM
1755162	YARD Broken Concrete Tie Yd 2 SW 127 A	WABYARDSW127A	APPR	12/30/14 06:39:49 AM
914407	YARD E Switch Point / Running Rail Side Worn Yd 1 SW 127 A CM 349	WABYARDSW127A	MONITOR	12/27/12 02:19:44 PM
1882563	YARD E Sw# 127B Broken concrete tie under I J	WABYARDSW127B	APPR	04/11/15 02:46:50 PM
914439	YARD M Ties Cracked (7) Yd 1 SW 129 A CM 35	WABYARDSW129A	MONITOR	12/27/12 02:53:26 PM
1441909	YARD Standard Joint Loose (N/Rail) Yd 1 SW 13	WABYARDSW133A	APPR	03/28/14 12:48:56 PM
1872848	Yard Track2W Sw133B Tie saver pad missing on closure rail	WABYARDSW133B	APPR	04/03/15 05:49:29 AM
1666776	YARD W 3rd Rail Approach Mismatched / Burnt SW 137	WABYARDSW137	APPR	10/08/14 03:04:08 PM
1872851	Yard Track3W Sw137 Tie saver pad missing on closure rail.	WABYARDSW137	APPR	04/03/15 05:52:29 AM
1703973	YARD W Switch Point Side Worn Yd 5 SW 141	WABYARDSW141	MONITOR	11/11/14 04:24:58 PM
1703986	YARD W Switch Point Side Worn Yd 5 SW 143	WABYARDSW143	APPR	11/11/14 04:31:27 PM

914415	YARD W Switch Point Worn Yd 11 SW 151	WABYARDSW151	MONITOR	12/27/12 02:34:20 PM
1776739	YARD LH Curve Stock Rail (Angle 27 deg) Yd 11 SW 151	WABYARDSW151	APPR	01/16/15 03:52:29 PM
1882557	YARD W Sw# 151 Curve closure 25 degrees angle wear	WABYARDSW151	APPR	04/11/15 02:42:56 PM
1742183	YARD IJ Battered / Running Rail Top Worn SW 161	WABYARDSW161	APPR	12/16/14 06:18:09 AM
1872845	Yard Track 2W Sw 163 Tie saver pad missing on closure rail	WABYARDSW163	APPR	04/03/15 05:37:09 AM
1665736	YARD W 3rd Rail Burnt / Mismatched SW 163	WABYARDSW163	APPR	10/07/14 03:25:07 PM
1775340	YARD IJ / Stock Rail Side Worn (Angle 25 deg) SW 165	WABYARDSW165B	APPR	01/15/15 02:40:35 PM
1790136	YARD Running Rail Top Worn (S/Rail) SW 165	WABYARDSW165B	APPR	01/29/15 02:37:47 PM
914399	YARD W 167- A Sw.Pt; Cl.RL; Frog guard rail & running rail side worn (27° FROG) (SW PT 33°)	WABYARDSW167A	MONITOR	12/27/12 01:49:50 PM
1775366	YARD LH Stock Rail (Angle 31 deg) Yd 1 SW 167 A	WABYARDSW167A	APPR	01/15/15 02:51:32 PM
1731452	YARD track #2, Sw# 167B, ST RL, SW PT, CL RL side worn (30° SW PT) (28° CL) (LH SW PT - 24°)	WABYARDSW167B	APPR	12/05/14 03:21:50 PM
1737754	YARD Trk 15, Sw# 171A, 1 cracked concrete tie	WABYARDSW171A	APPR	12/11/14 04:12:49 PM
1703971	YARD W, CM366+80, Trk 15, North running rail worn 33 degrees	WABYARDSW171A	MONITOR	11/11/14 04:19:53 PM
1459943	YARD W, Sw.19A, trk#15-west, frog needs welding	WABYARDSW19A	APPR	04/11/14 05:18:05 PM
1325359	YARD W Switch Point Side Worn Yd Tr 1 171B		MONITOR	12/17/13 03:15:52 PM
1666333	YARD W, Sw.171B, 3rd rail mismatch		APPR	10/08/14 05:26:54 AM
1756483	YARD Sw# 139, ST RL, SW PT, CL RL has side wear (32° SW PT) RTH		APPR	12/31/14 02:00:17 PM
1909297	(YARD) METRO MOW WEEKLY TRACK INSPECTION WALKING		APPR	05/01/15 03:30:38 AM

Work Order Tracking (Tr)

BMXAA4591I - Status change(s) completed successfully.

Notifications (1)

Go To

Find Work Order

Select Action

List Work Order Plans Actuals Activities Measurements Axle Configuration Related Records Safety Plan Log Failure Reporting

Work Order: 1918040 (YARD) METRO MOW WEEKLY TRACK INSPECTION WAL

Classification: MTA \ METRO

Classification Description: MTA - METRO

Asset: >>

Alias:

Location: CHAIN_MARK >> Metro Chain Markers

Work Location: >>

* Work Type: PM

Status: APPR

Status Date: 05/09/15 02:44:08 PM

Reported By: MTACRON >>

Phone:

Reported Date: 05/08/15 03:07:17 AM

On Behalf Of: >>

Consist: >>

Asset Details

Year:

Manufacturer: >>

Model: >>

Serial #: >>

Type: >>

Status:

Asset Condition:

Address Information

Service Address: >>

City:

Formatted Address:

State/Province:

Street Address: >>

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name M Alchin A Jefferson W Greenwood Date 5/16/2015 Page 1 of 1

Inspected From	W/Yard	To	E/Yard	Yard Tr #	All	WO#	1918040
----------------	--------	----	--------	-----------	-----	-----	---------


[illegible]

Item	COMMENTS
------	----------

[illegible]

Michael A Alchin

Trackwalkers Signature



Supervisory Certification